

для заказа - kyocera@kyocera-tools.ru

S-CCLN-GX (Boring / Internal Facing)

(Max. Overhang Length **L/D = ~3**)

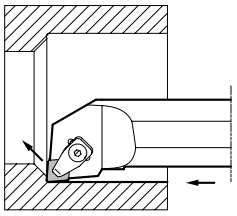

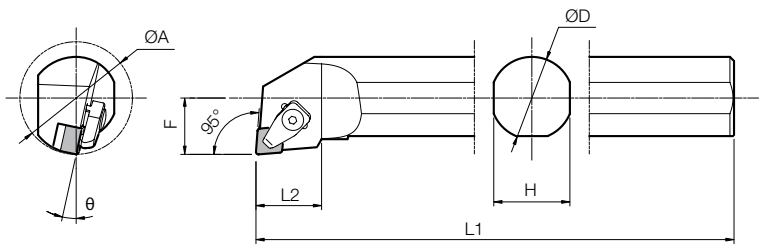

• Right-hand shown

Applicable Inserts

Cast Iron

B90

Ceramic




CNGX45..


Toolholder Dimensions

Part Number	Stock R	Stock L	Min. Bore Dia. ØA	Dimensions (mm) ØD	H	L1	L2	F	θ	Standard Corner-R(rε)	Spare Parts: Clamp Set	Wrench	Shim	Shim Screw	Recommended Cutting Conditions
															
S32S-CCLNR/L**12-40GX**	□	□	40	32	30	250	32	22	14°	1.2	CE-410	LW-4	-	-	F103~F104
S40T-CCLNR/L**12-50GX**	○	○	50	40	37	300	32	27	12°	1.2	CE-410	LW-4	SP-441P	M3X8	

S-CDUN-GX (Boring / Copying)

(Max. Overhang Length **L/D = ~3**)

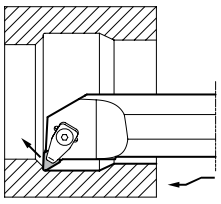

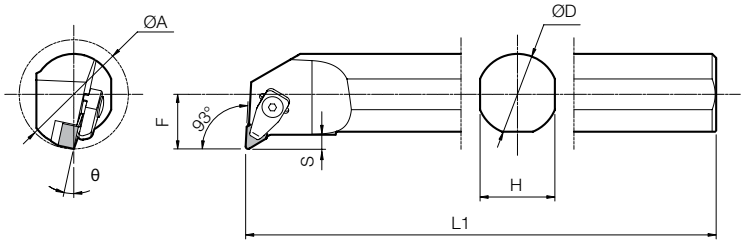


• Right-hand shown

Applicable Inserts

Cast Iron

B91

Ceramic




DNGX35..


Toolholder Dimensions

Part Number	Stock R	Stock L	Min. Bore Dia. ØA	Dimensions (mm) ØD	H	L1	L2	F	θ	Standard Corner-R(rε)	Spare Parts: Clamp Set	Wrench	Shim	Shim Screw	Recommended Cutting Conditions
															
S32S-CDUNR/L**12-40GX**	□	□	40	32	30	250	7.5	22	14°	1.2	CE-410	LW-4	-	-	F103~F104
S40T-CDUNR/L**12-50GX**	□	□	50	40	37	300	7.5	27	12°	1.2	CE-410	LW-4	SP-521P	M3X8	

S-CSKN-GX (Boring)

(Max. Overhang Length **L/D = ~3**)

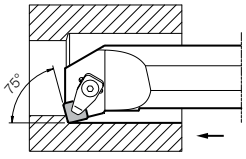

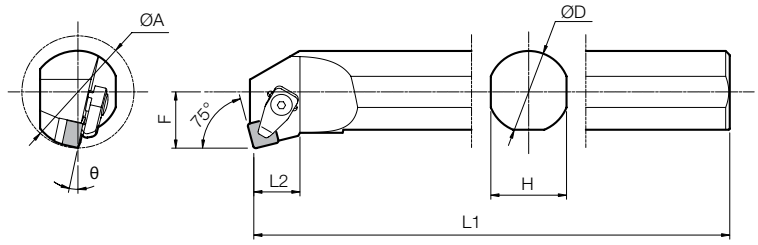

• Right-hand shown

Applicable Inserts

Cast Iron

B94

Ceramic



SNGX45..

Toolholder Dimensions

Part Number	Stock R	Stock L	Min. Bore Dia. ØA	Dimensions (mm) ØD	H	L1	L2	F	θ	Standard Corner-R(rε)	Spare Parts: Clamp Set	Wrench	Shim	Shim Screw	Recommended Cutting Conditions
															
S32S-CSKNR/L**12-40GX**	□	□	40	32	30	250	22.5	22	14°	1.2	CE-410	LW-4	-	-	F103~F104
S40T-CSKNR/L**12-50GX**	○	○	50	40	37	300	22.5	27	12°	1.2	CE-410	LW-4	SP-141P	M3X8	

kyocera@kyocera-tools.ru
www.kyocera-tools.ru

U.S. Stock Standard : ●
Made to Order : □
World Express (Shipping: 7-10 Business Days) : ○