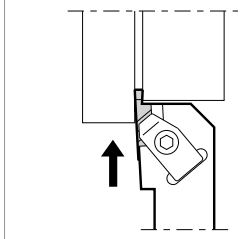
для заказа - kyocera@kyocera-tools.ru

KKC



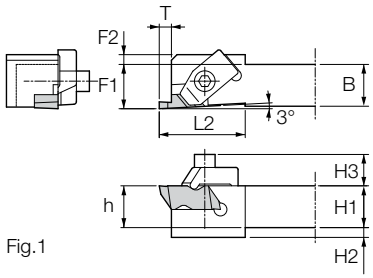


Fig.1

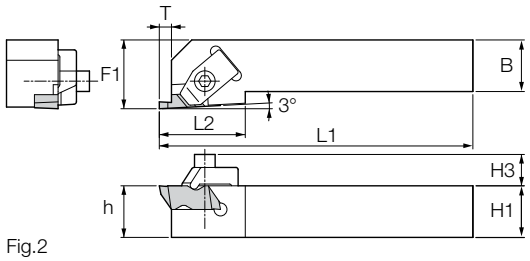


Fig.2

Right-hand shown

Toolholder Dimensions

Part Number	Stock R	Stock L	Unit	Dimensions H1=h	H2	H3	B	L1	L2	F1	F2	T*	Drawing	Spare Parts Clamp	Clamp Screw	Wrench
KKC☐ 1212M-2-150F	●		mm	12	-	9.2	12	150	19.05	12.25	-	3.5	Fig.1	CKC-2☐	SKC-2	(7/64 hex)
KKC☐ 6-2X	●	●	inch	0.375	-	0.362	0.375	2.500	0.750	0.562	-	0.138	Fig.2	CKC-2☐	SKC-2	(7/64 hex)
6-2CF	●	●		0.375	0.125	0.362	0.375	5.000	0.750	0.385	0.125	0.138	Fig.1			
8-2X	●	●		0.500	-	0.362	0.500	3.500	0.750	0.750	-	0.138	Fig.2			
8-2DF	●	●		0.500	-	0.362	0.500	6.000	0.750	0.510	-	0.138	Fig.1			
10-2DF	●	●		0.625	-	0.362	0.625	6.00	0.750	0.635	-	0.138	Fig.1			
12-2B	●	●		0.750	-	0.362	0.750	4.50	0.750	1.000	-	0.138	Fig.2	CKC-2☐	SKC-2	(7/64 hex)
12-2C	●			0.750	-	0.362	0.750	5.00	0.750	1.000	-	0.138	Fig.2			
16-2C	●	●		1.000	-	0.362	1.000	5.00	0.750	1.250	-	0.138	Fig.2			
16-2D	●	●		1.000	-	0.362	1.000	6.00	0.750	1.250	-	0.138	Fig.2			
12-3B	●	●		0.750	-	0.465	0.750	4.50	1.250	1.000	-	0.210	Fig.2	CKC-3☐	SKC-3	LW-156
12-3C	●	●		0.750	-	0.465	0.750	5.00	1.250	1.000	-	0.210	Fig.2			
16-3C	●	●		1.000	-	0.465	1.000	5.00	1.250	1.250	-	0.210	Fig.2			
16-3D	●	●		1.000	-	0.465	1.000	6.00	1.250	1.250	-	0.210	Fig.2			
20-3D	●	●		1.250	-	0.465	1.250	6.00	1.250	1.500	-	0.210	Fig.2			
16-4D	●	●		1.000	-	0.465	1.000	6.00	1.380	1.250	-	0.294	Fig.2			
20-4D	●	●		1.250	-	0.465	1.250	6.00	1.380	1.500	-	0.294	Fig.2			

* T dimension shows the distance from the toolholder to the cutting edge.

• Note: Right hand bars require right hand inserts and clamps
Left hand bars require left hand inserts and clamps

Applicable Inserts ➔ G30

Applicable Inserts

Toolholder	Inserts ➔ G30	
	2-Edge Use	1-Edge Use
KKC☐ …-2	KCGP-2, KCG-2, KCRP-2	
KKC☐ …-3	KCGP-3, KCG-3, KCRP-3	KCGDP-3
KKC☐ …-4	KCGP-4, KCRP-4	

kyocera@kyocera-tools.ru
www.kyocera-tools.ru

● : U.S. Stock Standard
○ : World Express (Shipping: 7-10 Business Days)