для заказа - kyocera@kyocera-tools.ru

External Threading (R-hand Thread / L-hand Thread)

External Threading

Right-Hand Thread

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M03

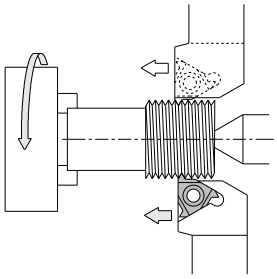

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M03

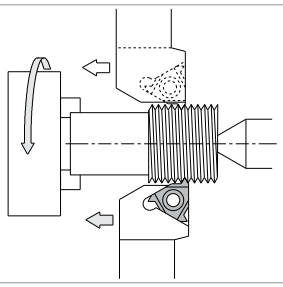

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M04

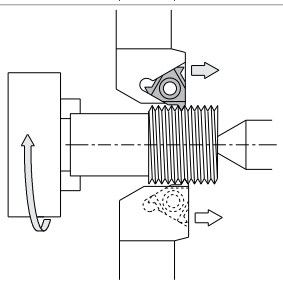

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M04

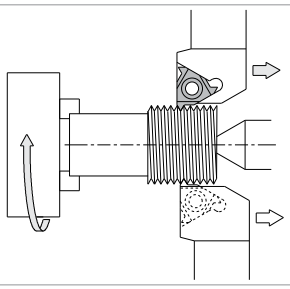

Left-Hand Thread

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M04

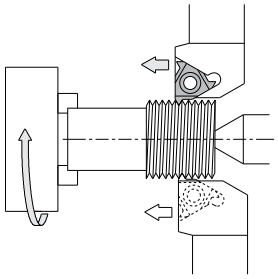

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M04

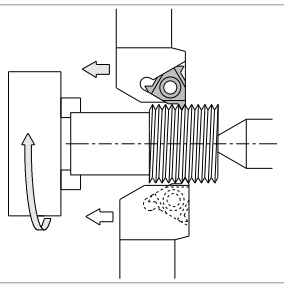

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M03

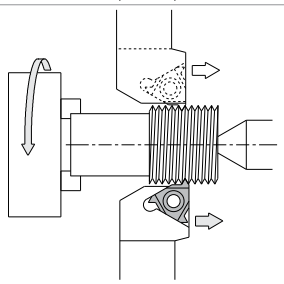

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M03

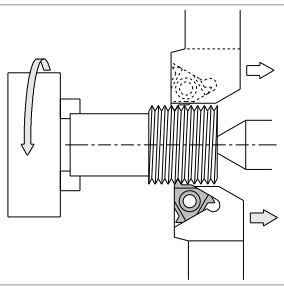

※ These tables are based on KTN / KTNS / KTT / KTTX Toolholder.

Internal Threading (R-hand Thread / L-hand Thread)

Internal Threading

Right-Hand Thread

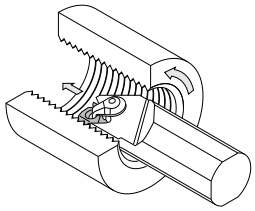

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M03

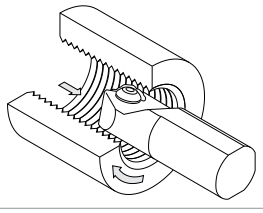

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M04

Left-Hand Thread

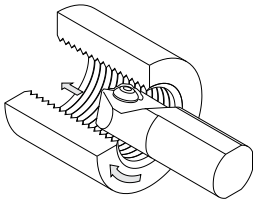

Toolholder	(L) L-hand
Insert	(L) L-hand
The direction of spindle revolution	M04

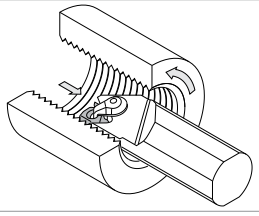

Toolholder	(R) R-hand
Insert	(R) R-hand
The direction of spindle revolution	M03

※ These tables are based on SIN / CIN type Toolholder.
For KITG type (for large internal threading), Left-hand Insert for Right-hand Toolholder, Right-hand Insert for Left-hand Toolholder.

kyocera@kyocera-tools.ru
www.kyocera-tools.ru