



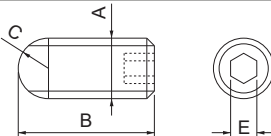



Shape	Description	Dimension (mm)						Angle (°)		Remarks	
		A	B	C	D	E	F	α	θ		
	HH 16X40 16X45 16X65 16X90 16X110 16X130	M16X2.0	40.0	24.0	16.0	14.0	-	-	-		
			45.0								
			65.0								
			90.0								
			110.0								
			130.0								
	HH 20X40 20X55 20X75 20X90 20X110 20X120 20X140 20X150 20X170	M20X2.5	40.0	30.0	20.0	17.0	-	-	-		
			55.0								
			75.0								
			90.0								
			110.0								
			120.0								
			140.0								
			150.0								
	HH 24X40 24X60 24X75 24X90 24X110 24X120 24X140 24X150 24X170	M24X3.0	40.0	36.0	24.0	19.0	-	-	-		
			60.0								
			75.0								
			90.0								
			110.0								
			120.0								
			140.0								
			150.0								
		HH 4X12	M4X0.7	10.0	7.0	4.0	3.0	2.0	-		-
		HS 3X4P 3X4 3X8 3X12 3X16	M3X0.5	3.9	-	-	1.5	-	-	-	Clamp screw equivalent to JIS B-1177
				4.0							
				8.0							
				12.0							
				16.0							
		HS 4X4P 4X4 5X5	M4X0.7	3.9	-	-	2.0	-	-	-	
				4.0							
			M5X0.8	5.0			2.5				
		HS 6X4P 6X6 6X14 6X22	M6X0.75	3.9	-	-	3.0	-	-	-	
				6.0							
				14.0							
				22.0							
		HS 8X10 8X12	M8X1.25	10.0	-	-	4.0	-	-	-	
				12.0							
		HS 10X10 10X16	M10X1.5	10.0	-	-	5.0	-	-	-	
				16.0							
		HS 12X12 12X16 12X18 12X20 12X25 12X30	M12X1.75	12.0	-	-	6.0	-	-	-	
				16.0							
				18.0							
				20.0							
25.0											
30.0											
HS 16X12 16X18 16X20	M16X2.0	12.0	-	-	8.0	-	-	-			
		18.0									
		20.0									
	HSB 4X8 ^{R/L}	M4X0.7	8.0	R2.0	-	2.0	-	-	-	R...shows Right-hand Thread, L...shows Left-hand Thread	
	LS -03	M5X0.8	10.0	M5X0.8	-	2.0	-	-	-		
	-03S		12.2			2.5					
	LS -03N		9.7	M5X0.8	-	2.0	-	-	-		
	-03SN		12.0			2.5					
	LS -05	M5X0.8	15.5	M5X0.8	-	2.0	2.0	-	-	With N is silver plated	

P



Spare Parts